

Subject: POWER ANTENNA WILL NOT GO UP	Bulletin No: 09-013/02R
	Last Issued: 12/11/2002

APPLICABLE MODEL(S)/VINS

2002 Miata models with Bose audio system with the following:

- Produced before July 2, 2002
- VIN from JM1 NB353* 20 229640 to JM1 NB353* 20 234737

Revision Note: The Warranty Information section has been revised.

DESCRIPTION

Customer complains that the power antenna will not go up if the audio unit is "on" while starting the engine, or if the ignition key is turned off and turned back on with the radio ON. Due to a logic change within the antenna assembly, the signal from the audio unit may be interrupted causing the antenna to become inoperative.

To correct this condition, replace the power antenna assembly with a revised part using the information outlined below.

REPAIR PROCEDURE

1. Verify customer complaint.
2. Replace power antenna assembly according to Workshop Manual (Section 09).
3. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
0000-81-142B	Power Antenna Assembly	1	

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership.

Bulletin No: 09-013/02R	Last Issued: 12/11/2002
--------------------------------	--------------------------------

WARRANTY INFORMATION

Note: This information applies to verified customer complaints on vehicles covered under normal warranty. Refer to the SRT microfiche for warranty term information.

Warranty Type	A
Symptom Code	B5
Damage Code	AB
Part Number Main Cause	0000-81-142B
Quantity	1
Operation Number / Labor Hours:	XX414XRX / 0.3